

EXHIBIT 22

TECHNICAL ASSISTANCE CENTER

**** GM RESTRICTED ****

Case No:	08662323	VIN:	Privacy
Date Opened:	20051226	Model Year:	2005
Date Closed:	12/31/2010	Model Series:	AZ
Dealer Code:	?187604	Mileage:	007082
Dealer Name:	Saturn of Lacrosse Onalaska	Dealer State:	WI
Dealer Phone:	6083921600	Division:	Saturn - GM

SYMPTOM ABSTRACT— STALL INTERMITTENT

RESOLUTION ABSTRACT-

UCC CODE 1-----

UCC-1 DESCRIPTION— Engine

UCC CODE 2-----

UCC-2 DESCRIPTION—

UCC CODE 3-----

UCC-3 DESCRIPTION—

12/26/2005 10:09:07 SBD Template - MOSKWA

STRATEGY BASED DIAGNOSTICS

1 Number of times in for the same condition

1 Number of days vehicle in dealership for same condition

N Y/N Is the vehicle modified/non-production accessories (List below)

Y SI Document ID Number supplied by Dealer _143341_____

Caller's name (First, Last, and Position)

Privacy technician

Customer concern -

Vehicle stalls while driving, engine easily restarts.

Dealer comments/diagnosis - (DTC'S, Parts, Repairs, Duplicated, SI

Search, Compare to like Vehicle?)

Another dealer replaced the MAF sensor and reprogrammed the ECM for a

TECHNICAL ASSISTANCE CENTER

**** GM RESTRICTED ****

Case No:	08662323	VIN:	<div>Privacy</div>
Date Opened:	20051226	Model Year:	2005
Date Closed:	12/31/2010	Model Series:	AZ
Dealer Code:	?187604	Mileage:	007082
Dealer Name:	Saturn of Lacrosse Onalaska	Dealer State:	WI
Dealer Phone:	6083921600	Division:	Saturn - GM

DTC that was set.

No DTC's set on this visit. Dealer wiggled connections at BC and ECM.

The grounds are clean and tight. Dealer has checked the connections at the UBEC.

TAC recommendation -

Advised dealer of PIC3421C - customer inadvertent shutting the vehicle off due to a heavy key chain contacting the driver's knee, and PIC3591A - check for wire chaffing at the UHJB.

12/26/2005 10:09:07 History - MOSKWA